


# **THERMALERT® TX™ SERIES**

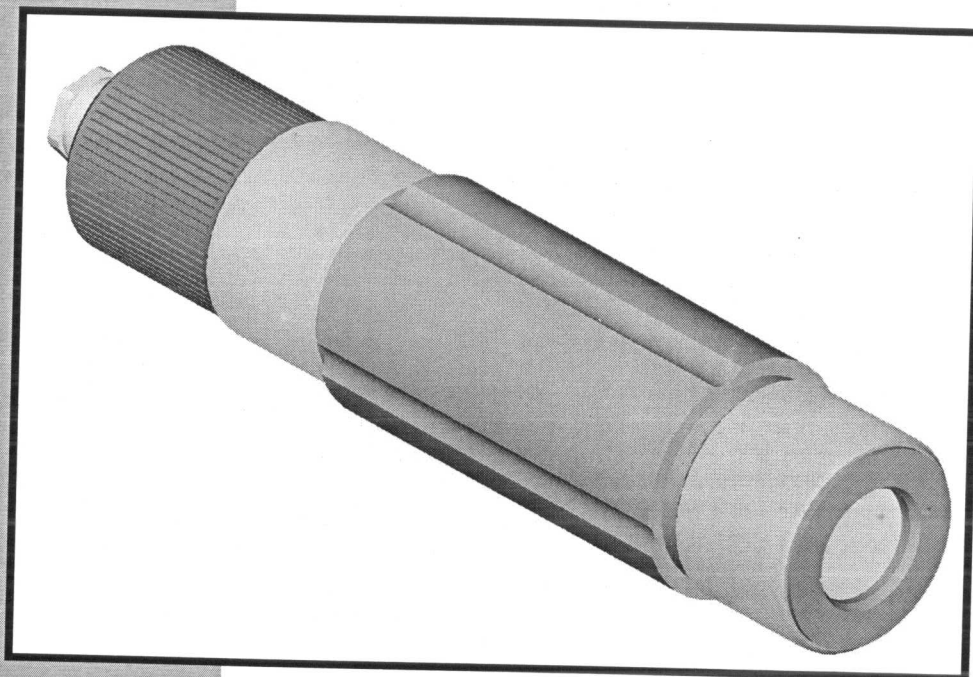

## **Operating Instructions**

**Raytek®**

*Noncontact Temperature Measurement*

Rev. M 01/2004  
50501

---

## Contacts

### Worldwide Headquarters

#### Raytek Corporation

Santa Cruz, CA USA

Tel: +1 800 227 - 8074 or

+1 831 458 - 1110

Fax: +1 831 458 - 1239

[automation@raytek.com](mailto:automation@raytek.com)

### Raytek China Company

Beijing, China

Tel: +86 10 6439 2255

Fax: +86 10 6437 0285

[info@raytek.com.cn](mailto:info@raytek.com.cn)

### South American Headquarters

#### Raytek do Brasil

Sorocaba, SP Brasil

Tel: +55 15 3217 6046

Fax: +55 15 3217 5694

[raytek@raytek.com.br](mailto:raytek@raytek.com.br)

### Raytek Japan, Inc.

Osaka, Japan

Tel: +81 6 4390 5015

Fax: +81 6 4390 5016

[info@raytekjapan.co.jp](mailto:info@raytekjapan.co.jp)

### European Headquarters

#### Raytek GmbH

Berlin, Germany

Tel: +49 30 478008 - 0

+49 30 478008 - 400 (sales/technical support)

Fax: +49 30 4710251

[raytek@raytek.de](mailto:raytek@raytek.de)

### Raytek United Kingdom

Milton Keynes, UK

Tel: +44 1908 630800

Fax: +44 1908 630900

[ukinfo@raytek.com](mailto:ukinfo@raytek.com)

### Raytek France

Palaiseau, France

Tel: +33 164 53 1540

Fax: +33 164 53 1544

[info@raytek.fr](mailto:info@raytek.fr)

**Internet:** <http://www.raytek.com/>

© Raytek Corporation.

Raytek and Thermalert are registered trademarks of Raytek Corporation.

All rights reserved. Specifications subject to change without notice.

---

---

## WARRANTY

The manufacturer warrants this product to be free from defects in material and workmanship under normal use and service for a period of two years from date of purchase except as hereinafter provided. This warranty extends only to the original purchaser. This warranty shall not apply to fuses or batteries. Factory calibration is warranted for a period of one year. The warranty shall not apply to any product which has been subject to misuse, neglect, accident, or abnormal conditions of operation or storage. Should the manufacturer be unable to repair or replace the product within a reasonable amount of time, purchaser's exclusive remedy shall be a refund of the purchase price upon return of the product.

In the event of failure of a product covered by this warranty, the manufacturer will repair the instrument when it is returned by the purchaser, freight prepaid, to an authorized Service Facility within the applicable warranty period, provided the manufacturer's examination discloses to its satisfaction that the product was defective. The manufacturer may, at its option, replace the product in lieu of repair. With regard to any covered product returned within the applicable warranty period, repairs or replacement will be made without charge and with return freight paid by the manufacturer, unless the failure was caused by misuse, neglect, accident, or abnormal conditions of operation or storage, in which case repairs will be billed at a reasonable cost. In such a case, an estimate will be submitted before work is started, if requested.

**THE FOREGOING WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS, OR ADEQUACY FOR ANY PARTICULAR PURPOSE OR USE. THE MANUFACTURER SHALL NOT BE LIABLE FOR ANY SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES, WHETHER IN CONTRACT, TORT, OR OTHERWISE.**

---

---

# TABLE OF CONTENTS

<b>1 SAFETY INSTRUCTIONS</b> .....	<b>1</b>
<b>2 TECHNICAL DATA</b> .....	<b>2</b>
2.1 MODELS AND PARAMETERS.....	2
2.2 OPTICAL DIAGRAMS.....	3
2.3 SCOPE OF DELIVERY .....	5
<b>3 BASICS</b> .....	<b>6</b>
3.1 MEASUREMENT OF INFRARED TEMPERATURE.....	6
3.2 DISTANCE AND SPOT SIZE.....	6
3.3 AMBIENT TEMPERATURE.....	6
3.4 ATMOSPHERIC QUALITY .....	7
3.5 ELECTRICAL INTERFERENCE.....	7
3.6 EMISSIVITY OF TARGET OBJECT.....	7
<b>4 INSTALLATION</b> .....	<b>8</b>
4.1 WIRE PARAMETERS FOR CURRENT LOOP .....	8
4.2 DIMENSIONS OF SENSOR .....	9
4.2.1 <i>Fixed Brackets</i> .....	9
4.3 CONNECTING THE SIGNAL LINE .....	9
4.4 BASIC MODEL .....	11
4.4.1 <i>Installation with a Controller</i> .....	11
4.5 SMART MODEL .....	11
4.5.1 <i>HART Protocol</i> .....	11
4.5.2 <i>HART RS232 Adapter</i> .....	12
4.5.3 <i>Installation of Smart Model</i> .....	12
4.5.4 <i>Address Assignment for Multiple Sensors</i> .....	13
4.5.5 <i>Installation of Multiple Sensors (digital, address mode)</i> .....	14
4.5.6 <i>Installation of Multiple Sensors (digital and analog, address mode)</i> .....	15
4.5.7 <i>Installation of Multiple Sensors (digital and analog, tag mode)</i> .....	15
4.5.8 <i>Alarm Output</i> .....	16
<b>5 OPTIONS</b> .....	<b>17</b>
5.1 AIR/WATER-COOLED HOUSING .....	17
5.1.1 <i>Connecting</i> .....	18
5.1.2 <i>Avoidance of Condensation</i> .....	19
<b>6 ACCESSORIES</b> .....	<b>20</b>
6.1 OVERVIEW .....	20
6.2 ADJUSTABLE BRACKET .....	21
6.3 AIR PURGE COLLAR .....	21
6.4 RIGHT ANGLE MIRROR .....	21
6.5 SIGHTING VIEWER .....	22
6.6 ADJUSTABLE PIPE ADAPTER.....	22
6.7 THERMOJACKET.....	23
6.8 INDUSTRIAL POWER SUPPLY .....	24
6.9 PROTECTIVE WINDOW .....	25

---



---

<b>7 MAINTENANCE.....</b>	<b>26</b>
7.1 TROUBLESHOOTING MINOR PROBLEMS .....	26
7.2 AUTOMATIC ERROR INDICATION .....	26
7.3 CLEANING THE LENS .....	27
7.4 REPLACING A PROTECTIVE WINDOW .....	27
7.4.1 Models produced after May 1999 .....	27
7.4.2 Models produced before May 1999 .....	28
<b>8 APPENDIX.....</b>	<b>29</b>
8.1 DETERMINATION OF EMISSIVITY .....	29
8.2 TYPICAL EMISSIVITY VALUES .....	29
8.3 DISPLAY MONITOR .....	33
8.3.1 Installation with the Sensor .....	33
8.4 INTRINSIC SAFETY .....	34

**INDEX**

---

## 1 Safety Instructions

This document contains important information, which should be kept at all times with the instrument during its operational life. Other users of this instrument should be given these instructions with the instrument. Eventual updates to this information must be added to the original document. The instrument can only be operated by trained personnel in accordance with these instructions and local safety regulations.

### Acceptable Operation

This instrument is intended only for the measurement of temperature. The instrument is appropriate for continuous use. The instrument operates reliably in demanding conditions, such as in high environmental temperatures, as long as the documented technical specifications for all instrument components are adhered to. Compliance with the operating instructions is necessary to ensure the expected results.

### Unacceptable Operation

The instrument should not be used for medical diagnosis.

### Replacement Parts and Accessories

Use only original parts and accessories approved by the manufacturer. The use of other products can compromise the operational safety and functionality of the instrument.

### Instrument Disposal

Disposal of old instruments should be handled according to professional and environmental regulations as electronic waste.

### Operating Instructions

The following symbols are used to highlight essential safety information in the operation instructions:



Helpful information regarding the optimal use of the instrument.



Warnings concerning operation to avoid instrument damage.



Warnings concerning operation to avoid personal injury.

Pay particular attention to the following **safety instructions**.



The instrument could be equipped with a Class 2 laser. Class 2 lasers shine only within a visible area at an intensity of 1 mW. Looking directly into the laser beam can produce a slight, temporary blinding effect, but does not result in physical injury or damage to the eyes, even when the beam is magnified by optical aids. At any rate, closing the eye lids is encouraged when eye contact is made with the laser beam. Pay attention to possible reflections of the laser beam. The laser functions only to locate and mark surface measurement targets. Do not aim the laser at people or animals.



Use in 110 / 230 V electrical systems can result in electrical hazards and personal injury if not properly protected. All instrument parts supplied by electricity must be covered to prevent physical contact and other hazards at all times.

# Technical Data

## 2 Technical Data

### 2.1 Models and Parameters

In general, there are two models available. The basic model (TXC, for °C, and TXF, for °F) and the Smart model (TXS). The model descriptor is followed by the description for the optical characteristic, see following page):

Optical characteristic	LTPSF	LTSF	MTSF	G5SF (Glass)	P7SF (Plastics)	HTSF
Temperature range (°C)	- 18 to 500	- 18 to 500	200 to 1000	250 to 1650	10 to 360	500 to 2000
Temperature range (°F)	0 to 1000	0 to 1000	400 to 1800	500 to 3000	50 to 650	950 to 3600
Optical resolution (90%)	15 : 1	33 : 1	33 : 1	33 : 1	33 : 1	60 : 1
Spectral response (µm)	8 to 14	8 to 14	3.9	5.0	7.9	2.2
Close focus	CF	CF1, CF2	CF1, CF2			CF1, CF2

#### Thermal Parameters

Accuracy	± 1 % of reading or ± 1.4°C (2.5°F), whichever is greater (at 23°C ± 5°C (73°F ± 9°F) ambient temperature)
Repeatability	± 0.5 % of reading or ± 0.7°C, whichever is greater
Detector	Micromachined Thermopile
Response time (95 %)	165 ms (100 ms HT models, 65 ms for G5 models)
Temperature resolution (NET)	0.1 K (LT models), 1K (all other models)
Emissivity	0.10 to 1.00 (all models)

#### Electrical Parameters

Output	4 to 20 mA
Maximum loop impedance	750 Ohm
Alarm	24 V / 150 mA (only Smart models)
Signal processing	°C/°F, Averaging, Peak/Valley Hold,
Smart models	Emissivity, internal housing temperature, external ambient temperature
Basic model	Emissivity
Power	24 VDC ± 10 %, 100 mA, if HART communication is required, otherwise 12 to 24 VDC +20 %

#### General Parameters

Environmental rating	IP 65, IEC 529, NEMA 4
Ambient operating range	without cooling 0 to 70°C (32 to 160°F) with air cooling max. 120°C (250°F) with water cooling max. 175°C (350°F) with ThermoJacket max. 315°C (600°F)
Storage temperature	- 18°C to 85°C (0 to 185°F)
Vibration	IEC 68-2-6 (MIL STD 810D), 3 axis, 11 to 200 Hz, 3 G
Shock	IEC 68-2-27 (MIL STD 810D), 3 axis, 11 ms, 50 G
Dimensions / Weight	Sensor L: 187 mm; Ø: 42 mm / 330 g (Length 7.36 inches, dia 1.65 inches) with water cooling L: 187 mm; Ø: 60 mm / 595 g (Length 7.36 inches, dia 2.36 inches)

Specifications subject to change without notice.



#### Declaration of Conformity for the European Community

This instrument conforms to the following standards:


EMC: EN61326-1,

Safety: EN61010-1:1993 / A2:1995

## 2.2 Optical Diagrams

The optical diagrams indicate the target spot diameter at any given distance between the target object and the sensing head.

All target spot sizes indicated in the optical diagrams are based on 90% energy.

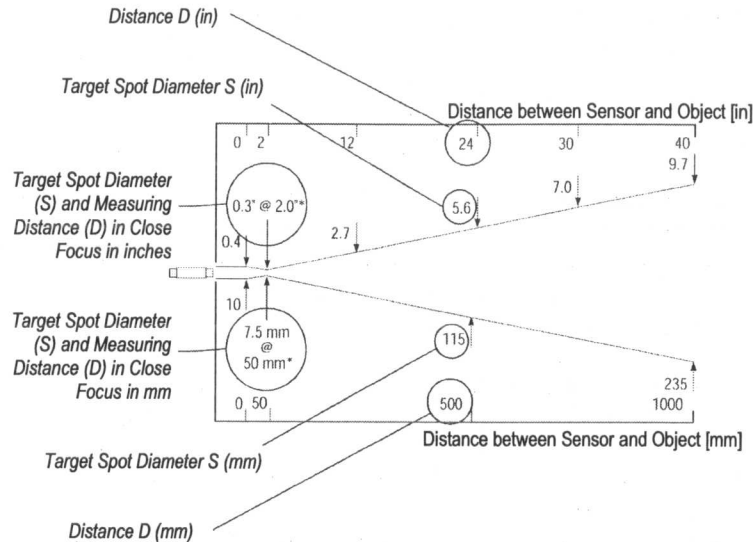

Close Focus D : S = Proportion between Distance (D) to Target Spot and Target Spot Diameter (S) in Close Focus

Far Field D : S = Proportion with Distances 10 times greater than the Close Focus Distance

### Calculating the Target Spot Size

To calculate the target spot size from two known points within an optical diagram the following formula can be used:

$$S_x = S_n + \left[ \frac{(D_x - D_n)}{(D_f - D_n)} \cdot (S_f - S_n) \right]$$

$S_x$  = unknown diameter of target spot

$S_n$  = smallest known diameter of target spot

$S_f$  = greatest known diameter of target spot

$D_x$  = distance to unknown target spot

$D_n$  = distance to smaller known target spot

$D_f$  = distance to greater known target spot

Figure 1: How to read the optical diagrams

# Technical Data

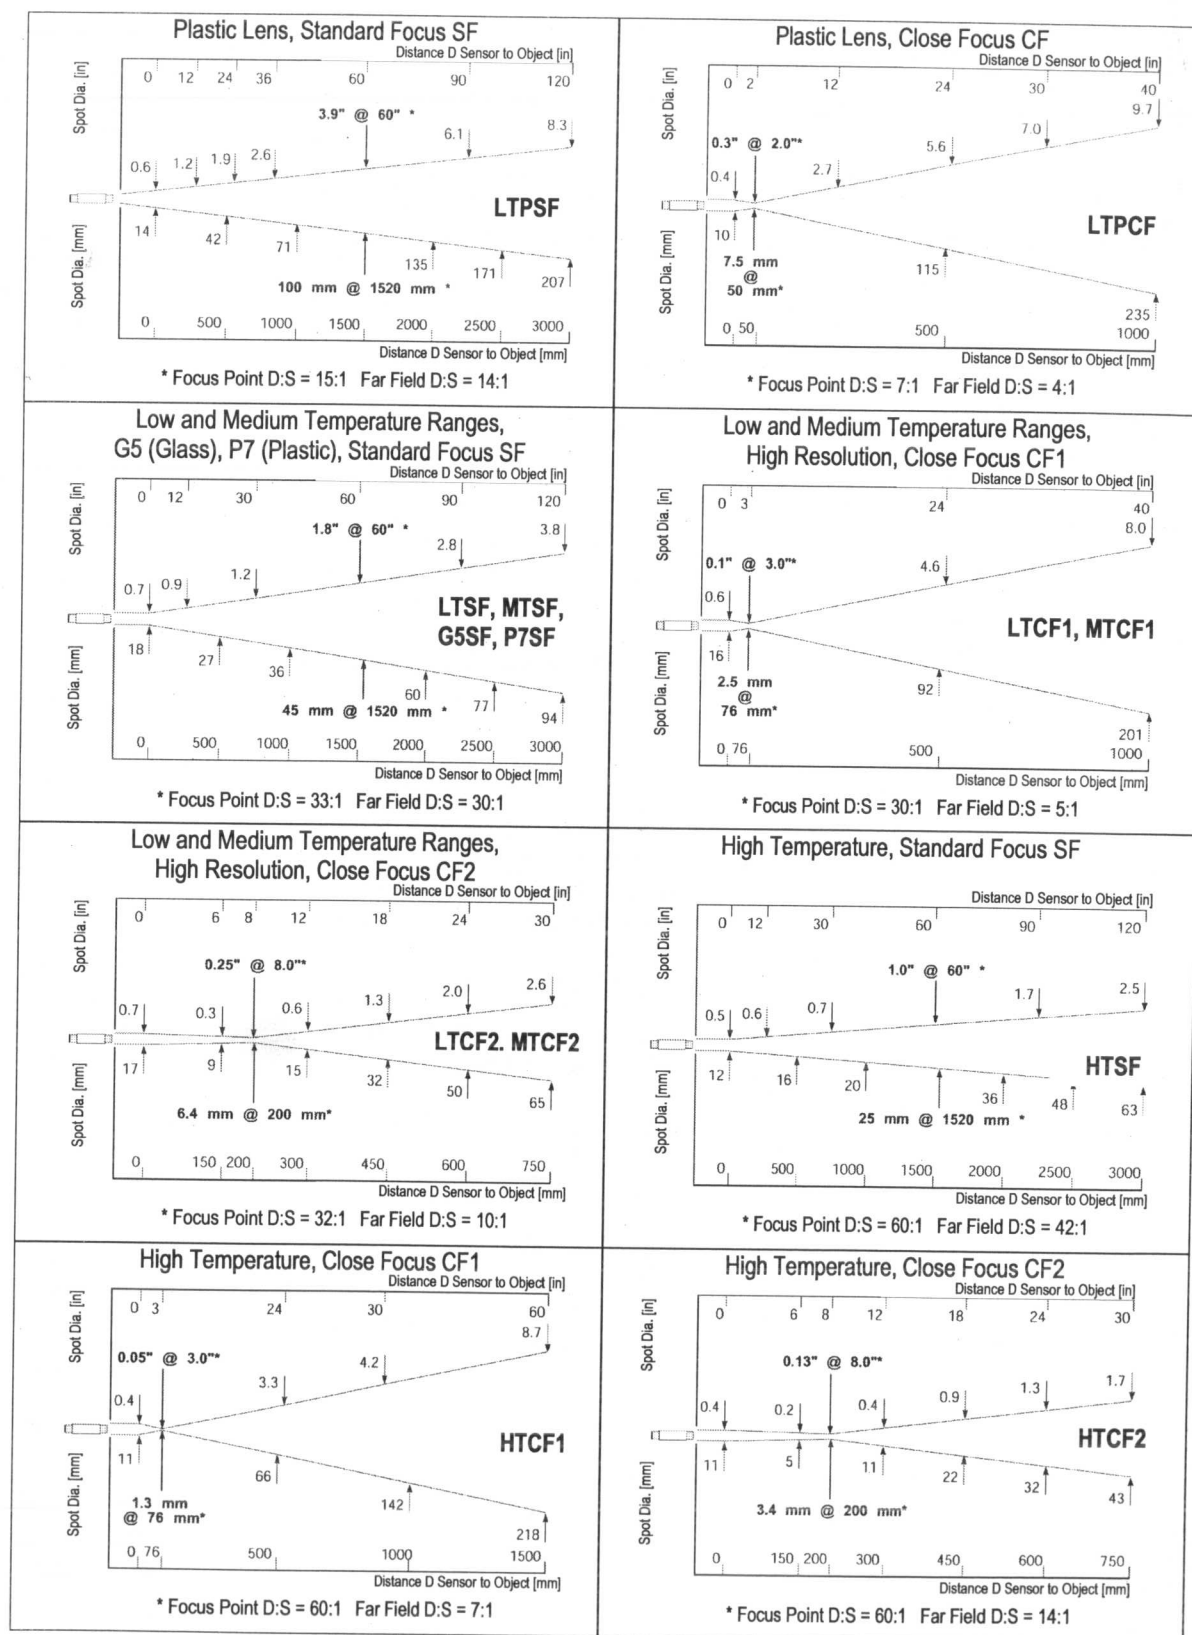


Figure 2: Optical Diagrams

### 2.3 Scope of Delivery

All models are provided with:

- operator's manual
- a fixed bracket
- mounting nut
- model have 4 to 20 mA output.



## Basics

### 3 Basics

#### 3.1 Measurement of Infrared Temperature

Everything emits an amount of infrared radiation according to its surface temperature. The intensity of the infrared radiation changes according to the temperature of the object. Depending on the material and surface properties, the emitted radiation lies in a wavelength spectrum of approximately 1 to 20  $\mu\text{m}$ . The intensity of the infrared radiation ("heat radiation") is dependent on the material. For many substances this material-dependent constant is known. It is referred to as "emissivity value", see appendix 8.2 Typical Emissivity Values on page 29.

Infrared thermometers are optical-electronic sensors. These sensors are able to detect "radiation of heat". Infrared thermometers are made up of a lens, a spectral filter, a sensor, and an electronic signal processing unit. The task of the spectral filter is to select the wavelength spectrum of interest. The sensor converts the infrared radiation into an electrical parameter. The connected electronics generate electrical signals for further analysis. As the intensity of the emitted infrared radiation is dependent on the material, the required emissivity can be selected on the sensor.

The biggest advantage of the infrared thermometer is its ability to measure in the absence of contact. Consequently, surface temperatures of moving or hard to reach objects can easily be measured.

#### 3.2 Distance and Spot Size

The desired spot size on the target will determine the maximum measurement distance and the necessary focus length of the optical module. To avoid erroneous readings the target spot size must contain the entire field of view of the sensor. Consequently, the sensor must be positioned so the field of view is the same as or smaller than the desired target size. For a list indicating the available focus models and their parameters see Figure 2: Optical Diagrams on page 4.

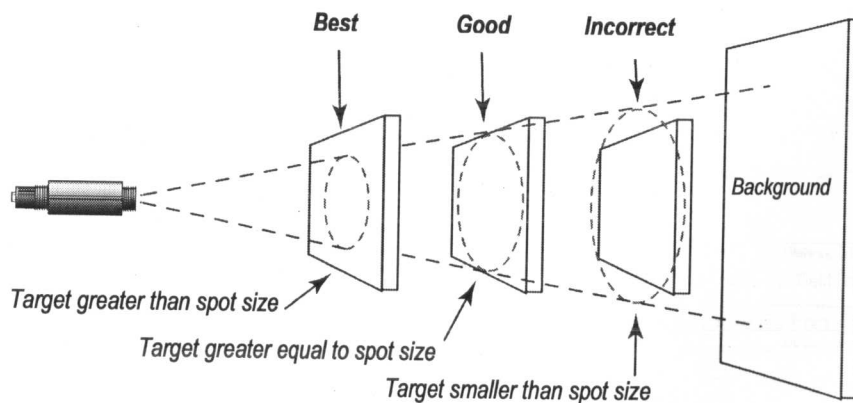


Figure 3: Proper Sensor Placement

#### 3.3 Ambient Temperature

The sensing head is designed for measurements in ambient temperatures between 0°C and 70°C (32 to 160°F). In ambient conditions above 70°C (160°F), a water or air cooled housing is available to extend the operating range to 120°C (250°F) with air cooling and to 175°C (350°F) with water cooling. When using the water cooled housing, it is strongly recommended to use the supplied air purge collar to

avoid condensation on the lens. In ambient conditions up to 315°C (600°F), the ThermoJacket housing should be used.

### 3.4 Atmospheric Quality

In order to prevent damage to the lens and erroneous readings, the lens should always be protected from dust, smoke, fumes, and other contaminants. For this purpose an air purge collar is available. You should only use oil free, clean "instrument" air.

### 3.5 Electrical Interference

To minimize electrical or electromagnetic interference, follow these precautions:

- Mount the sensor as far away as possible from possible sources of interference such as motorized equipment producing large step load changes.
- Ensure a fully insulated installation of the sensor (Avoid ground loops!).
- Make sure the shield wire in the sensor cable is earth grounded at one location.

### 3.6 Emissivity of Target Object

Determine the emissivity of the target object as described in appendix 8.1 Determination of Emissivity on page 29. If emissivity is low, measured results could be falsified by interfering infrared radiation from background objects (such as heating systems, flames, fireclay bricks, etc. close beside or behind the target object). This type of problem can occur when measuring reflecting surfaces and very thin materials such as plastic films and glass.

This measuring error when measuring objects with low emissivity can be reduced to a minimum if particular care is taken during installation, and the sensing head is shielded from these reflecting radiation sources.

# Installation

---

## 4 Installation

The infrared sensor provides a standard two-wire current loop output and has been designed for use in harsh industrial environments. The Smart model allows the remote programming of the temperature range, alarm values and other functions.

### 4.1 Wire Parameters for Current Loop

You should use shielded twisted pairs or multiple twisted pairs with a joint shield.

#### Line length

The maximum line length of one two-wire line per loop is dependent on the loop resistance (R), the capacitance per length unit (C), and the capacitance of the sensor  $C_s$  (5000 pF). It is calculated as follows:

$$l \approx \frac{65 \cdot 10^6}{R \cdot C} - \frac{C_s + 10000}{C}$$

l ... in meter  
R ... in Ohm  
C ... in pF / m  
 $C_s$  ... in pF

For simplifying the formula use, the parameters must be provided as "naked values" (in the given dimension)!

#### Typical values for wire cross sections (copper)

- |  |                                   |       |
|--|-----------------------------------|-------|
| • up to 250 m line length:                 | 0.2 mm <sup>2</sup> cross section | AWG24 |
| • up to 650 m line length:                 | 0.5 mm <sup>2</sup> cross section | AWG20 |
| • up to 1500 m multiple wire line lengths: | 1.5 mm <sup>2</sup> cross section |       |
| • up to 3000 m single wire line lengths:   | 2.5 mm <sup>2</sup> cross section |       |

## 4.2 Dimensions of Sensor

All sensors are supplied with a fixed bracket and mounting nut. Alternatively, the sensor may also be mounted using customer-supplied accessories. A pipe adapter and other accessories may also be used (see section 6.1 Overview on page 20).



All sensors and accessories are supplied with 1.5" 20 UN 2 threads.

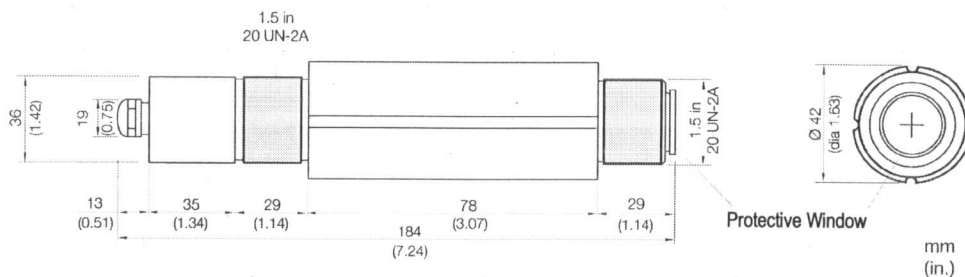


Figure 4: Dimensions of the Sensor

### 4.2.1 Fixed Brackets

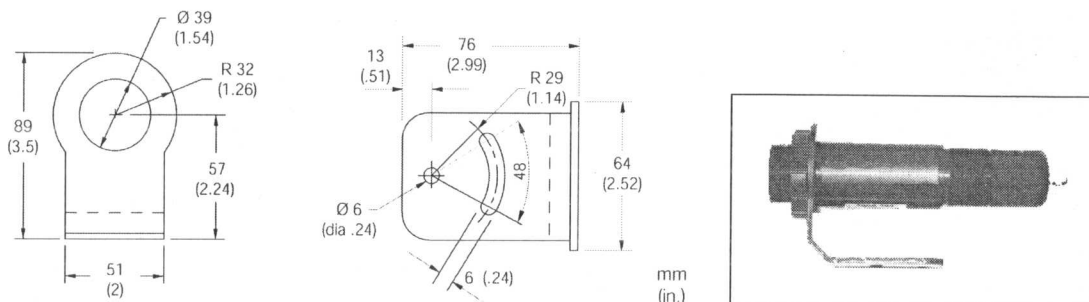



Figure 5: Dimensions (left), sensor delivered with fixed bracket XXXTXXACFB (right)

## 4.3 Connecting the Signal Line


Before connecting the cable to the sensor (standard and Smart models) you should unscrew the cap from the back of the sensor. Proceed as follows:

# Installation


1.) Prepare the cable, remove about 6cm (2.36 in) of the insulation. Shorten the shield to about 1cm (0.4 in). Tin-coat the connecting leads.

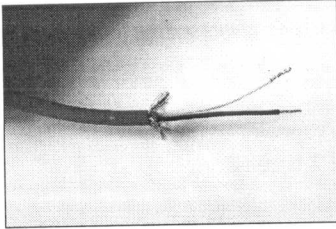


3.) Open the PG threaded cable gland.

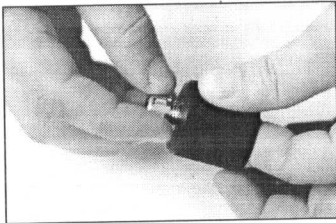

5.) Feed the prepared cable through the components of the cable gland.

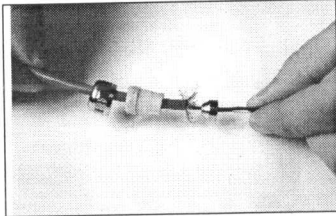


7.) Place the PG screwed cable gland back into the outer cap. Tighten the PG nut firmly.

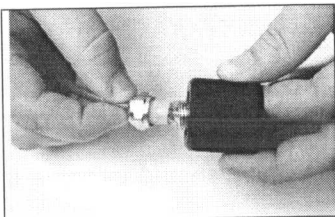


9.) Screw the end-cap firmly onto the sensor until it is tight (flush with the sensor body).

**IMPORTANT:** Neither the end-cap nor the cable gland should have any play after tightening.


2.) Unscrew the end-cap until it can be pulled away from the sensor body.

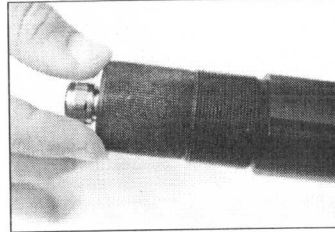


4.) The cable gland consists of a PG nut, a plastics part and a metal cone ring.

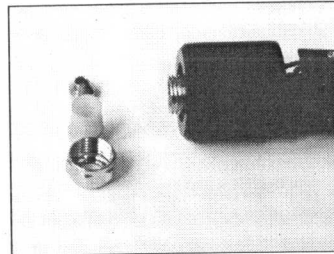

6.) Make sure to have a proper contact between the braided shield and the metal cone ring.

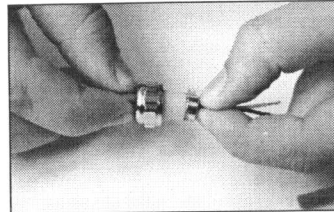

8.) Connect the signal wires to the screw terminals.

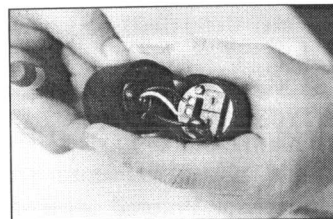

The screwed cable gland described above is not a strain relief! Consequently, the cable must be clamped accordingly during the installation. The outside diameter of the connecting cables (round cable) should lie between 4 to 6 mm (about 0.2 inches). Note that it might be necessary to additionally seal the cable entry to allow IP65 with smaller cables.

## 4.4 Basic Model

The standard model is available for °C or °F. It provides a 2 pin screw-jumper terminal for connecting the 4 to 20 mA current loop. The polarity is indicated on the panel.

Above the screw-jumper terminal there are two rotary switches for emissivity setting. Emissivity is preset at the factory at 0.95 (see figure). The appendix lists typical emissivity values for common materials, see appendix 8.2 Typical Emissivity Values on page 29.

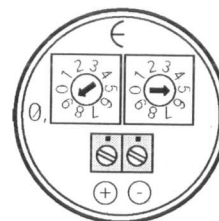


Figure 6: Back panel of basic model

### 4.4.1 Installation with a Controller

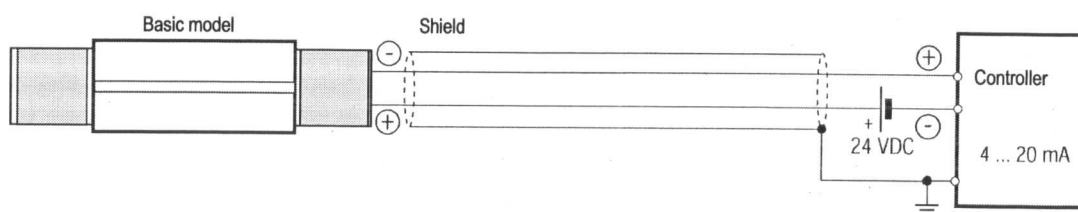


Figure 7: Typical installation of basic model

## 4.5 Smart Model

The Smart model has a 3 pin screw-jumper terminal for connecting the 4 to 20 mA current loop and the alarm output. The terminal assignment is marked on the panel. To allow clip leads from a HART adapter to attach directly to the sensor for setting sensor parameters, raise the removable terminal strip about 4 mm (0.2 inches) from the rear panel board and connect across the exposed (+) and (-) pins. For example, via line terminals, a lap-top with a HART adapter can be used for programming the sensor.

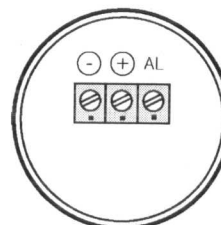


Figure 8: Back panel of basic model

### 4.5.1 HART Protocol

Originally, transmission of information was in one direction only, from sensing head to process control. The parameters monitored for the production of a product were not changed. In order to use the same technological equipment to manufacture a multitude of differing products, it must be possible to quickly alter many process parameters. This has an effect on the sensing head. Measuring range, accuracy and alarm values must be redefined. It would be extremely inconvenient if it were necessary to reprogram the sensing head at the unit every time. The HART protocol arose from this requirement. It allows the application of "intelligent" sensors. The sensing heads can be programmed from the control room. This means that information is transmitted in two directions. The sensing head provides analog measured values to the control room via the 4 to 20 mA current loop. The sensing head can be reprogrammed from the control room by means of bi-directional transmission of digital



## Installation

signals. The superposition of analog and digital signals is described by the HART protocol. Sensors which are programmable in this way are called SMART sensors. Apart from the Smart model, a HART(RS232) adapter is also available. This adapter allows programming of infrared sensing heads using a computer with an RS232 interface.

### 4.5.2 HART RS232 Adapter

The adapter (XXXTXACRCK) allows both remote setting and signal processing of one or more sensors in a 4 to 20 mA current loop. A software suitable for a WINDOWS PC are supplied together with the adapter. The adapter has a 25-pin terminal connector for connecting to an RS232 interface. Screw terminals are provided for connecting the 4 to 20 mA current loop, terminal 4 (S<sub>2</sub>) and terminal 5 (S<sub>1</sub>).

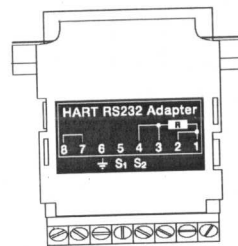


Figure 9: HART RS232 adapter

**i** Terminal 6 is connected internally to computer chassis ground.

### 4.5.3 Installation of Smart Model

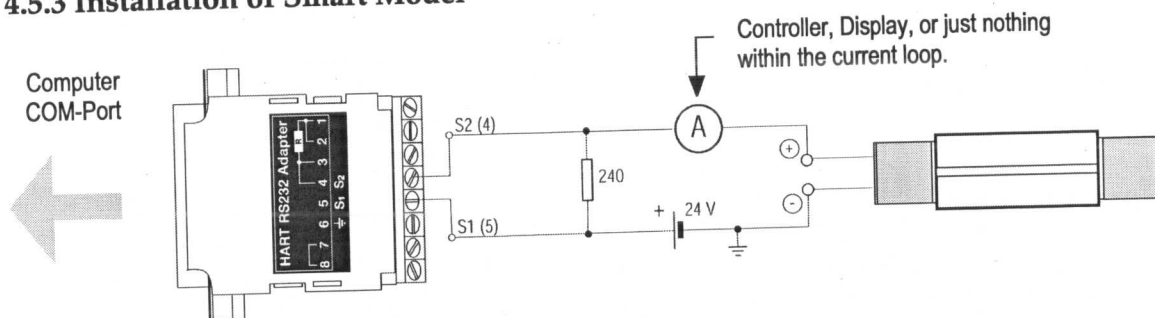


Figure 10: Typical installation of Smart model using the external resistor

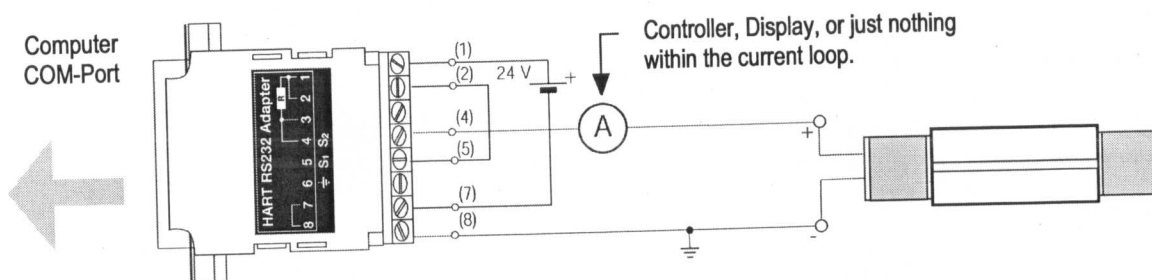


Figure 11: Typical installation of Smart model using the internal resistor

## 4.5.4 Address Assignment for Multiple Sensors



The sensing heads are factory-programmed with "Polling Address 0".

When installing a number of sensors, note that each sensing head must first be assigned a separate polling (1 to 15). To do this, use the software supplied with the Smart model, and the HART adapter:

- Install the software, see software manual.
- Connect the HART adapter to the RS232 interface of your computer.
- Connect the Smart model which is to be programmed to the adapter. Use either the installation with the external resistor or the alternative with the internal resistor.
- For configuring the sensor, go to the <Sensor> <Sensor Setup> menu in the software.

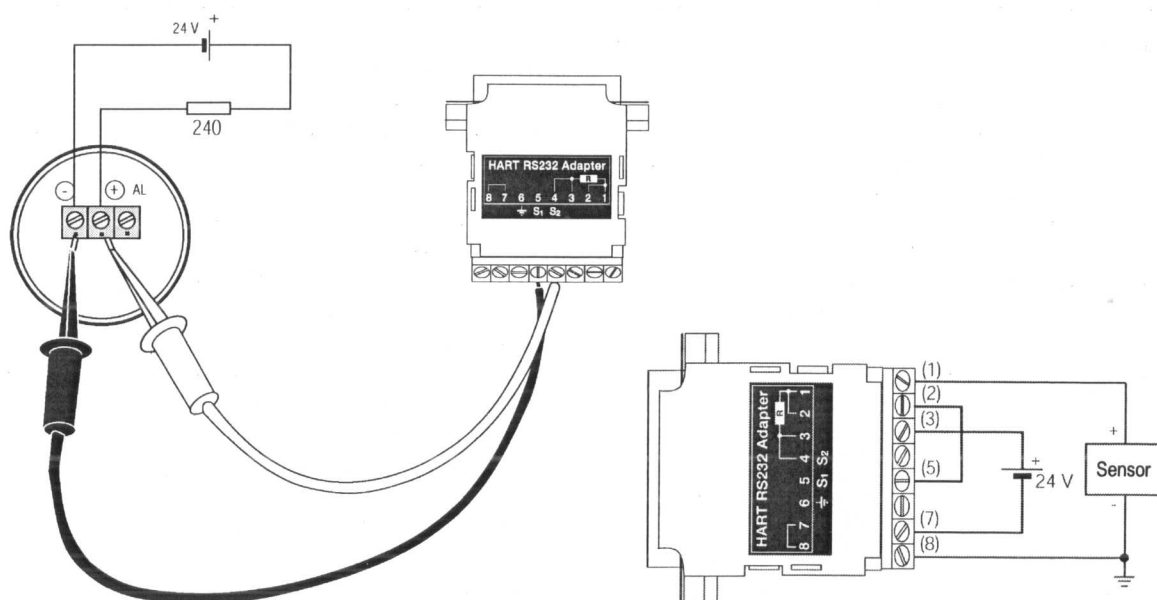


Figure 12: Address assignment with external (left) and internal (right) resistor

# Installation

## 4.5.5 Installation of Multiple Sensors (digital, address mode)

- Maximum 15 sensors can be used. The polling address must always be >0.
- Communication is **purely digital**, no analog current output is provided
- Set each sensor failsafe mode to "minimum"

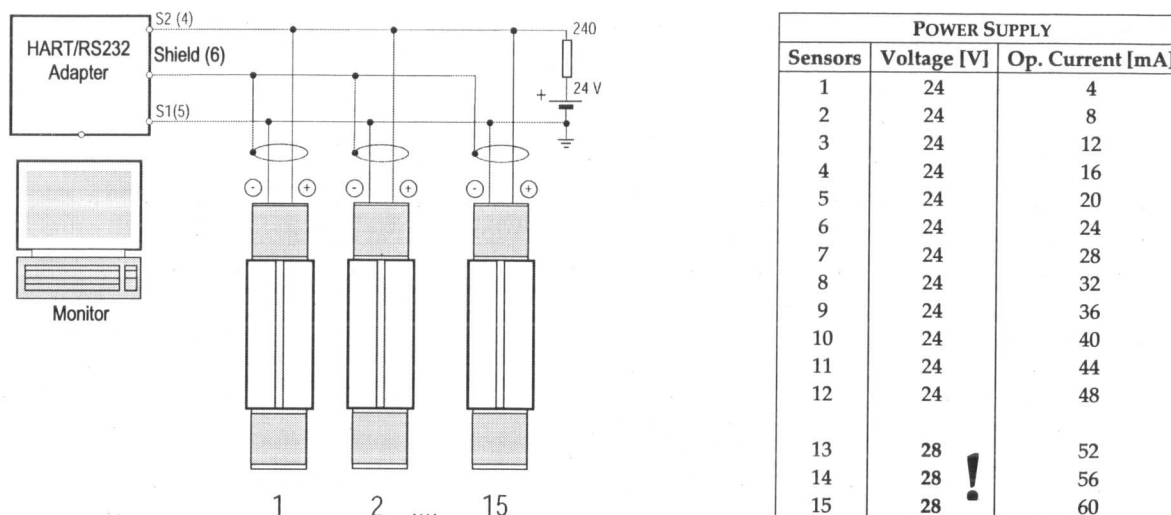


Figure 13: All sensors in digital communication using the external resistor

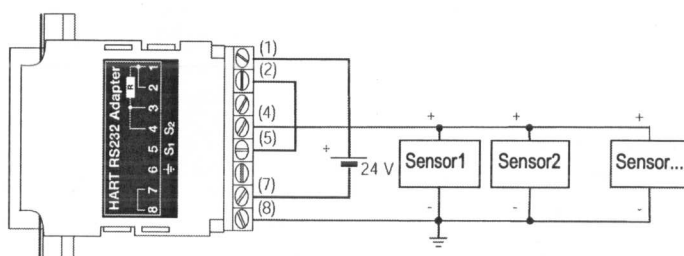


Figure 14: Multiple sensors using the internal resistor



The sensing heads are factory-programmed with "Polling Address 0".

When installing a number of sensors, note that each sensing head must first be assigned a separate polling address (1 to 15), section 4.5.4 Address Assignment for Multiple Sensors on page 13).

## 4.5.6 Installation of Multiple Sensors (digital and analog, address mode)

- Maximum 12 sensors can be used.
- Analog and digital communication for the sensor with polling address 0.
- Communication for the remaining 11 sensors purely digital.

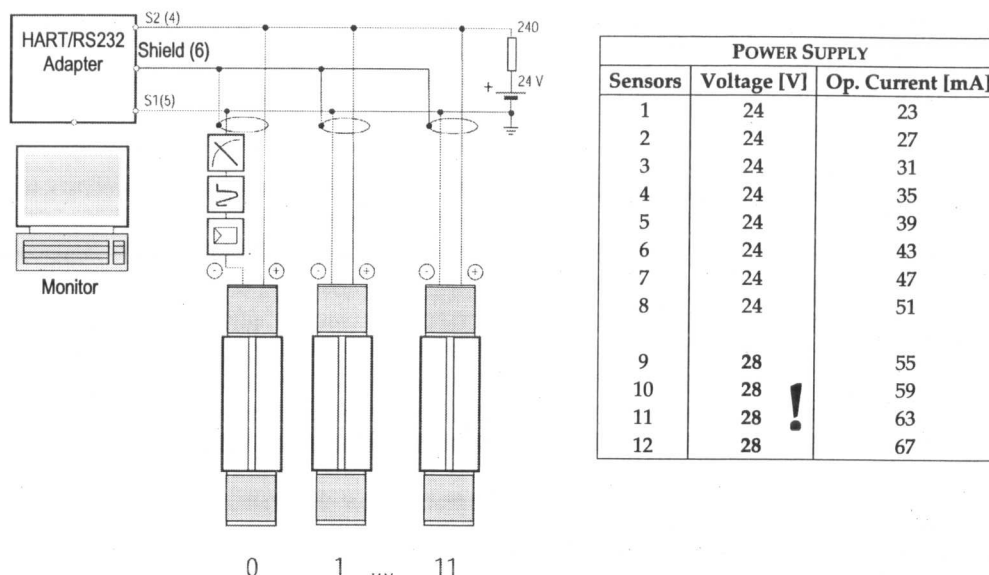


Figure 15: All sensors in digital communication, first sensor also with analog current output



The sensing heads are factory-programmed with "Polling Address 0".

When installing a number of sensors, note that each sensing head must first be assigned a separate polling address (0 to 11), section 4.5.4 Address Assignment for Multiple Sensors on page 13).

## 4.5.7 Installation of Multiple Sensors (digital and analog, tag mode)

To run a sensor with analog current output, the sensor is to address with polling address 0. In case of having multiple sensors running with analog current output, the polling address can not be the criteria to distinguish between the sensors, because every sensor would be set to the same address. To avoid this, a sensor can be named by means of a so called **tag**. The tag will be stored within the units memory and can later be used to identify the sensor uniquely.

# Installation

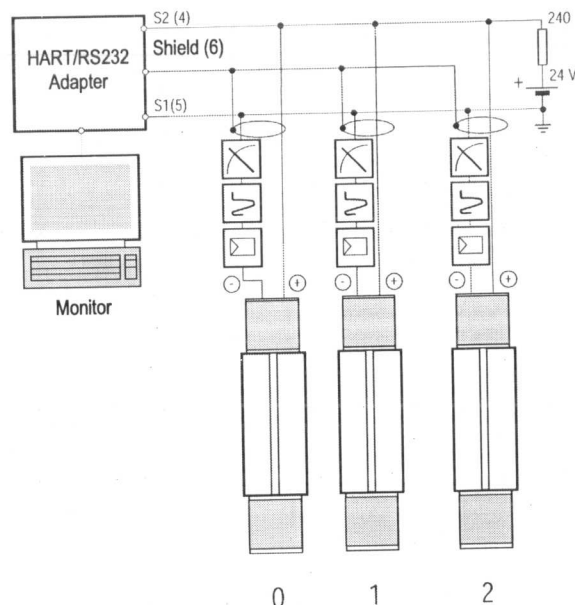


Figure 16: All sensors in digital communication and with analog current output



In case of having more than 3 units, please contact your local dealer for additional information for installing.

## To prepare sensors for tag mode:

1. The sensing heads are factory-programmed with "Polling Address 0".
2. Start up the software with a single sensor (address mode).
3. Define a unique tag for the sensor, see the <Advanced Setup> in the menu <Sensor> <Sensor Setup>.
4. Exit the software.
5. Repeat steps 2 to 4 for every additional sensor.
6. Start up the software with multiple sensors, select <Define Scan List>, input the tags for all requested sensors.

## 4.5.8 Alarm Output

The alarm output of the Smart model is not electrically isolated. The maximum current carrying capacity is 150 mA. Use the circuit diagram. The LED is operated with 10 mA and could be used as an indicator, or as an optocoupler. The alarm current does not influence the signal current (4 to 20 mA current loop).

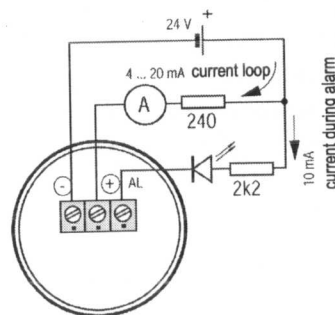


Figure 17: Using the alarm output

## 5 Options

A full range of options for various applications and environments are available. Options are factory-installed and must be specified at the time of placing the order:

- °C or °F (basic model only)
- Air/Water cooled housing (Option: ...W), includes air purge
- Intrinsically-safe rating, PTB-approval (Smart models only) (Option: ...IS)
- ISO Calibration Certificate (XXXTXCERT) based on PTB certified transfer pyrometers

### 5.1 Air/Water-Cooled Housing

The Air/Water-Cooled Housing option allows the sensor to be used in ambient temperatures up to 120°C (250°F) with air-cooling, and 175°C (350°F) with water-cooling. The cooling media should be connected using 1/8" NPT stainless steel fittings. Air flow should be 1.4 to 2.5 l/sec at 25°C (77°F). Water flow should be approximately 1.0 to 2.0 l/min (water temperature between 10 and 27°C (50 to 80.6°F). Chilled water below 10°C (50°F) is not recommended, see section 5.1.2 Avoidance of Condensation on page 19.

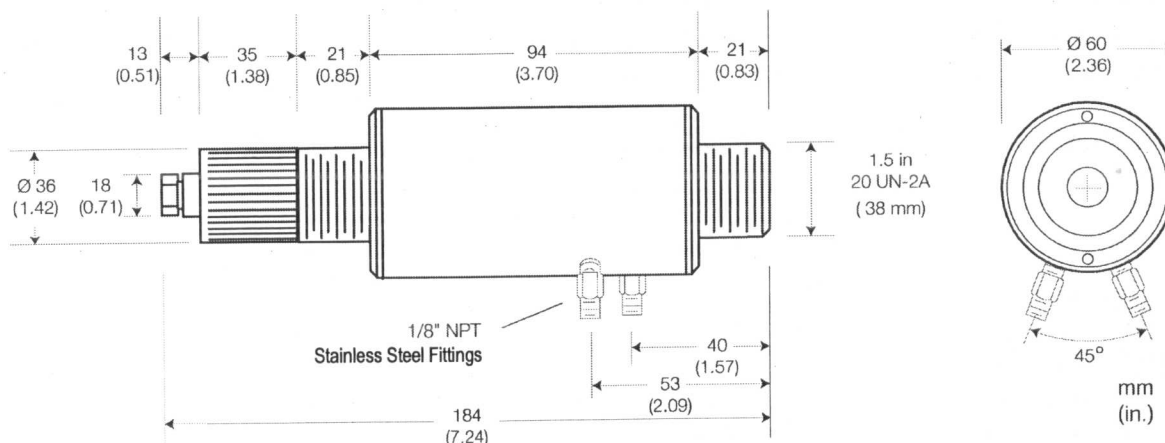


Figure 18: Sensor with Air/Water-Cooled Housing



## Options

### 5.1.1 Connecting

**EUROPEAN CUSTOMERS:** This information is especially important to European customers concerning the use of NPT and metric threads.

As a standard the accessory parts are supplied with stainless steel fittings and non-metric 1/8" NPT threads. If you intend to supply the cooling media through pipes or hoses, we recommend using the following additional accessories.

For any further information on material, range of types offered, terms of delivery and payment, please directly contact the manufacturer:

**B.E.S.T. Ventil- und Fitting GmbH München**

Max-Anderl-Straße 2


85375 Neufahrn bei Freising

Tel.: (08165) 95 28 -0

Fax: (08165) 95 28 10

The following adapters and supplementary parts shall serve as an example only and are taken from the manufacturer's delivery program at the time of printing this manual. Prior to any order, you should therefore inquire at B.E.S.T. Ventil- und Fitting GmbH about the current order numbers.

- Thread Adapter - metric pipe to NPT inside thread
- Thread Adapter - inch-type pipe to NPT inside thread

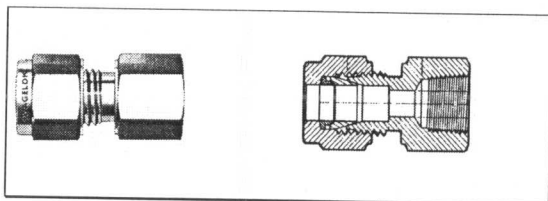


Ordering Example:

Inner Thread NPT (in.)	Pipe Outer Ø	Order number:
1/8	4 mm	SS - 4M0-7-2
1/8	6 mm	SS - 6M0-7-2
1/8	8 mm	SS - 8M0-7-2
Inner Thread NPT (in.)	DIN-ISO-Outer Thread	Order number:
1/8	4 mm	SS - 2-A-2RS

Related sealing ring:

S - 4 - RS.2B (only DIN-ISO Outer Threads)

- Supporting tube for PVC or Tygon hoses

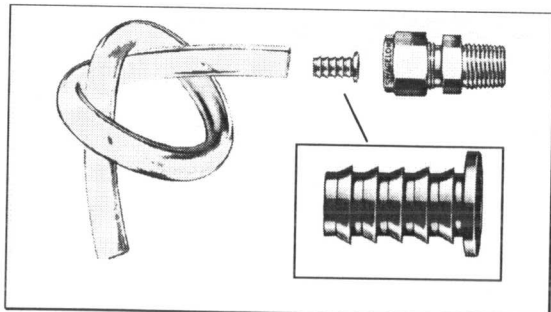

Ordering Example:

Tube Outer Ø	Tube Inner Ø	Order number:
6	4	SS - 6M5-4M
8	6	SS - 8M5-6M

### 5.1.2 Avoidance of Condensation

If environmental condition makes water cooling necessary, it is strictly recommended to check whether condensation will be a real problem or not.

Water cooling also causes a cooling of the air in the inner part of the device. Thereby the capability of the air to store water decreases. The relative humidity increases and can reach 100% very quickly. In case of a further cooling, the surplus water steam will come out as water (condensation). The water will condense on the lenses and the electronics resulting in possible damage to the sensor. Condensation can even happen on an IP65 sealed housing.



**There is no warranty repair possible in case of condensed water within the housing!**

To avoid condensation, the temperature of the cooling media and the flow rate have to ensure a minimum device temperature. The minimum device temperature depends on the ambient temperature and the relative humidity, please consider the following table.

		Relative Humidity [%]																		
		10	15	20	25	30	35	40	45	50	55	60	65	70	75	80	85	90	95	100
Ambient Temperature [°C/°F]	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32
	5/41	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	5/41
	10/50	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	5/41	5/41	5/41	5/41	5/41	10/50
	15/59	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	0/32	5/41	5/41	5/41	5/41	10/50	10/50	10/50	10/50	10/50	15/59
	20/68	0/32	0/32	0/32	0/32	0/32	0/32	5/41	5/41	5/41	10/50	10/50	10/50	10/50	15/59	15/59	15/59	15/59	15/59	20/68
	25/77	0/32	0/32	0/32	5/41	5/41	10/50	10/50	10/50	10/50	15/59	15/59	15/59	20/68	20/68	20/68	20/68	20/68	20/68	25/77
	30/86	0/32	0/32	5/41	5/41	10/50	10/50	15/59	15/59	15/59	20/68	20/68	20/68	20/68	25/77	25/77	25/77	25/77	25/77	30/86
	35/95	0/32	5/41	10/50	10/50	15/59	15/59	20/68	20/68	20/68	25/77	25/77	25/77	25/77	30/86	30/86	30/86	30/86	30/86	35/95
	40/104	0/32	5/41	10/50	10/50	15/59	20/68	20/68	25/77	25/77	30/86	30/86	30/86	30/86	35/95	35/95	35/95	35/95	35/95	40/104
	45/113	0/32	10/50	15/59	15/59	20/68	25/77	25/77	30/86	30/86	35/95	35/95	35/95	35/95	40/104	40/104	40/104	40/104	40/104	45/113
	50/122	5/41	10/50	15/59	20/68	25/77	30/86	30/86	35/95	35/95	40/104	40/104	40/104	40/104	45/113	45/113	45/113	45/113	45/113	50/122
	60/140	15/59	20/68	25/77	30/86	30/86	35/95	40/104	40/104	40/104	45/113	45/113	50/122	50/122	50/122	50/122	50/122	50/122	50/122	60/140
	70/158	20/68	25/77	35/95	40/104	45/113	50/122	50/122	50/122	50/122	60/140	60/140	60/140	60/140	70/158	70/158	70/158	70/158	70/158	70/158
	80/176	25/77	35/95	40/104	45/113	50/122	50/122	50/122	60/140	60/140	60/140	60/140	60/140	60/140	70/158	70/158	70/158	70/158	70/158	80/176
	90/194	35/95	40/104	50/122	50/122	60/140	60/140	60/140	70/158	70/158	70/158	70/158	70/158	80/176	80/176	80/176	80/176	80/176	80/176	90/194
	100/212	40/104	50/122	50/122	60/140	60/140	70/158	70/158	80/176	80/176	80/176	80/176	80/176	90/194	90/194	90/194	90/194	90/194	90/194	100/212

Tab. 1: Minimum device temperatures [°C/°F]

Example:

Ambient temperature = 50 °C

Relative humidity = 40 %

Minimum device temperature = 30 °C

The use of lower temperatures is at your own risk!

Temperatures higher than 60°C / 140°F are not recommended due to the temperature limitation of the device.

# Accessories

## 6 Accessories

### 6.1 Overview

#### For all models:

- Mounting Nut
- Fixed Mounting Bracket
- Adjustable Bracket
- Air Purge Collar
- Right Angle Mirror
- Sighting Viewer
- Adjustable Pipe Adapter
- ThermoJacket Housing
- Industrial Power Supply (110 / 230 VAC – 24 VDC)
- Protective Window for lens protection
- Panel Mount Display

XXXTXXACMN  
XXXTXXACFB  
XXXTXXACAB  
XXXTXXACAP  
XXXTXXACRA  
XXXTXXACSV  
XXXTXXAPA  
RAYTXXTJ3M  
XXXTXACDCPS

RAYGPC/RAYGPCM

#### For Smart model:

- PC communications software, RS232 adapter
- Field Calibration Kit incl. XXXTXACRCK

XXXTXACRCK  
RAYTXSCAL

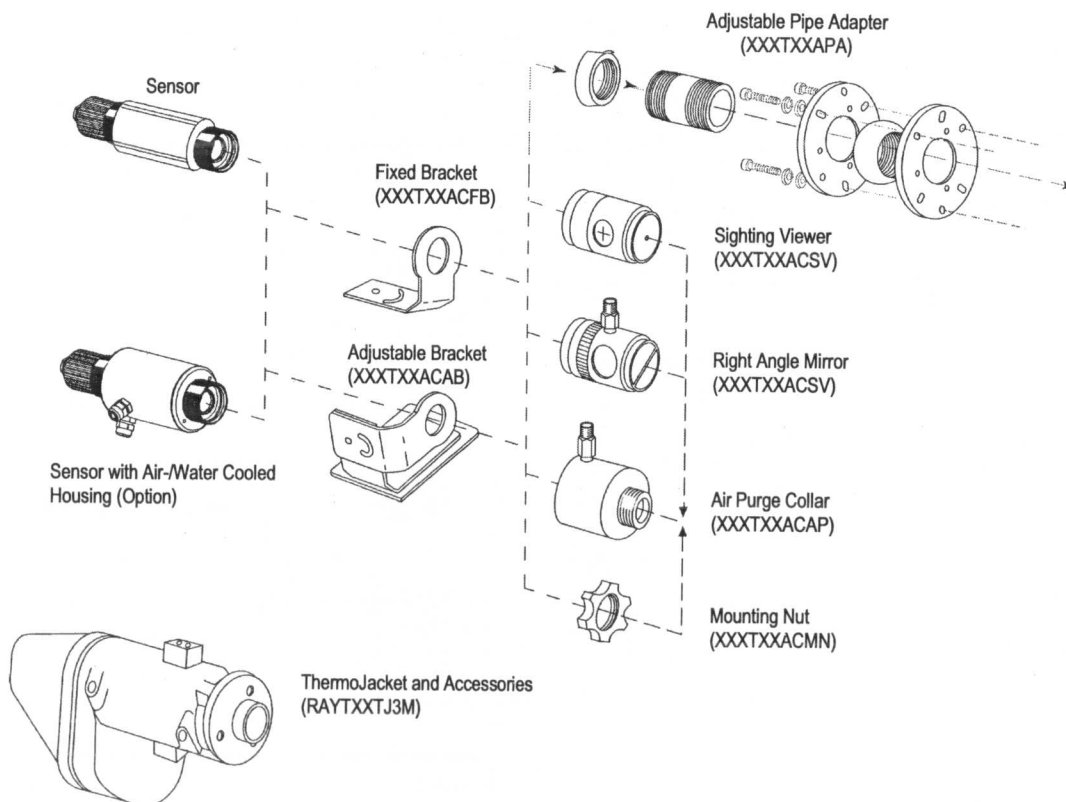


Figure 19: Overview to the available accessories

## 6.2 Adjustable Bracket

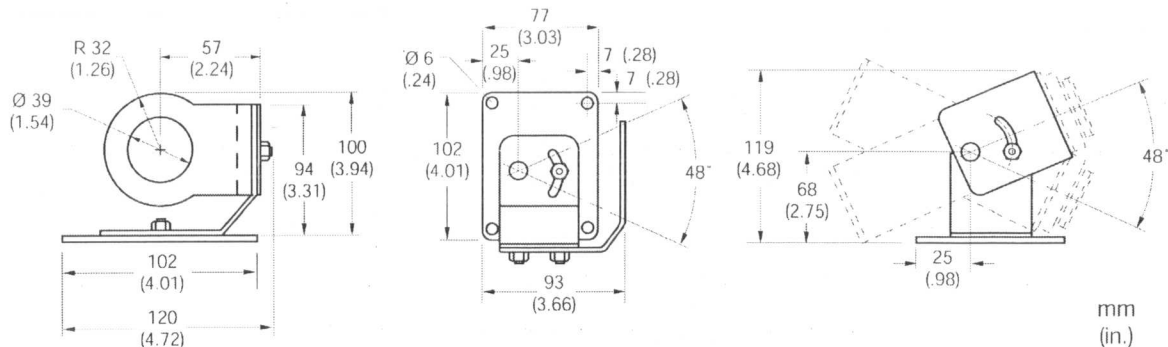


Figure 20: Adjustable Bracket (XXXTXXACAB)

## 6.3 Air Purge Collar

The Air Purge Collar (XXXTXXACAP) is used to keep dust, moisture, airborne particles, and vapors away from the lens. It can be mounted before or after the bracket. The air flow is passed through 1/8" NPT stainless steel fitting onto the front aperture. Air flow should be a maximum of 0.5 to 1.5 l/sec. Clean, oil free air is recommended.

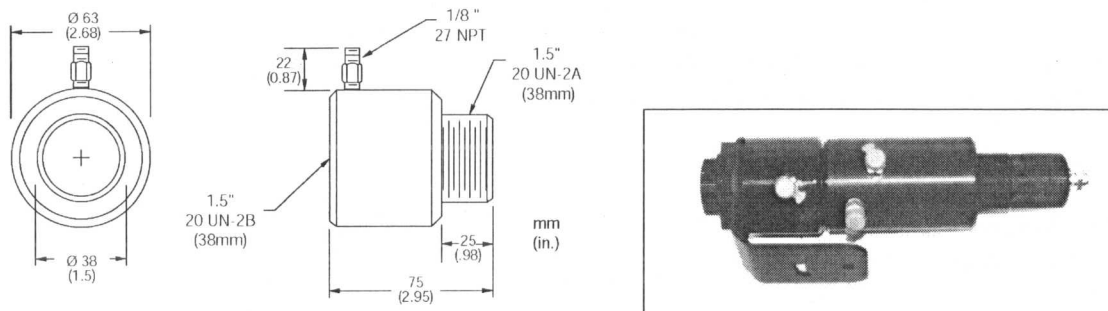


Figure 21: Dimension of Air Purge Collar (left), Sensor with Air Purge Collar (right)

## 6.4 Right Angle Mirror

The Right Angle Mirror (XXXTXXACRA) is used to turn the field of view by 90° against the sensor axis. It is recommended when space limitations or excessive radiation do not allow to directly align the sensor to the target. The mirror must be installed after the bracket and after the Air Purge Collar and screwed in fully. In dusty or contaminated environments, air purging is required to keep the mirror surface clean.

## Accessories

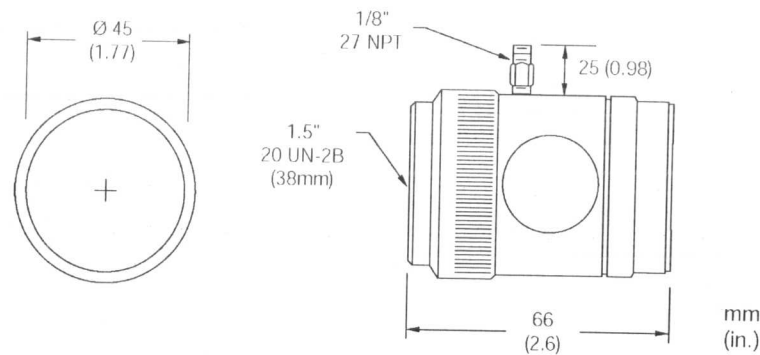


Figure 22: Right Angle Mirror



When using the Right Angle Mirror, adjust the emissivity settings downward by 5%. For example, for an object with an emissivity of 0.65, you adjust the value down to 0.62. This correction accounts for energy losses in the mirror.

### 6.5 Sighting Viewer

The Sighting Viewer (XXXTXXACSV) is used to aid in the alignment of the standard sensor. It is used when the object is small and far from the sensor as well as when it is difficult to obtain a direct in-line sighting. It can be used both with and without the Air Purge Collar, but not with the Right Angle Mirror. First secure the sensor to the bracket using the mounting nut or the Air Purge Collar. Next screw on the Sighting Viewer Tool fully. Now, position and secure the bracket. When the alignment is complete, do not forget to remove the Sighting Viewer Tool.

The Sighting Viewer Tool has the same dimensions as the Right Angle Mirror.

### 6.6 Adjustable Pipe Adapter

The adjustable pipe adapter (XXXTXXACPA) is available to connect a sighting tube or conduit to a sensor with or without water/air cooled housing.

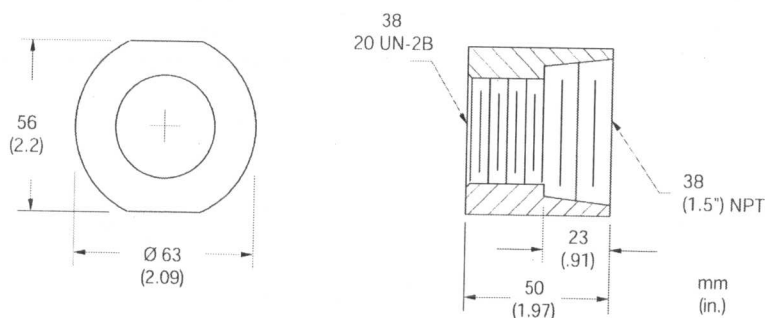


Figure 23: Adjustable Pipe Adapter

### 6.7 ThermoJacket

The ThermoJacket® allows use of the sensor in ambient temperatures up to 315°C (600°F). The rugged cast aluminum housing completely encloses the sensor and provides water cooling as well as air purging. Sensing heads can easily be installed or removed with the ThermoJacket housing in its mounted position.

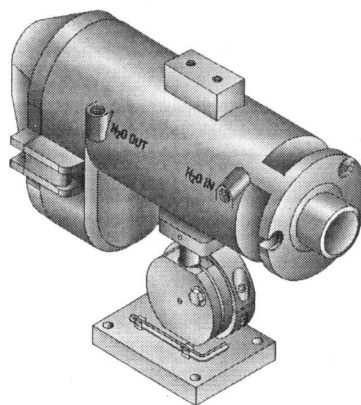


Figure 24: ThermoJacket (RAYTXXTJ3)

For more information see the ThermoJacket's manual.



## Accessories

### 6.8 Industrial Power Supply

The industrial power supply (type S-25-24) transforms an input voltage of 100 – 240 VAC into an output voltage of 24 VDC / 1.1 A. Do not twist the mounting screws deeper than 2 mm (0.08 in.) into the mounting threads.



To prevent electrical shocks, the power supply must be used in protected environments (cabinets)!

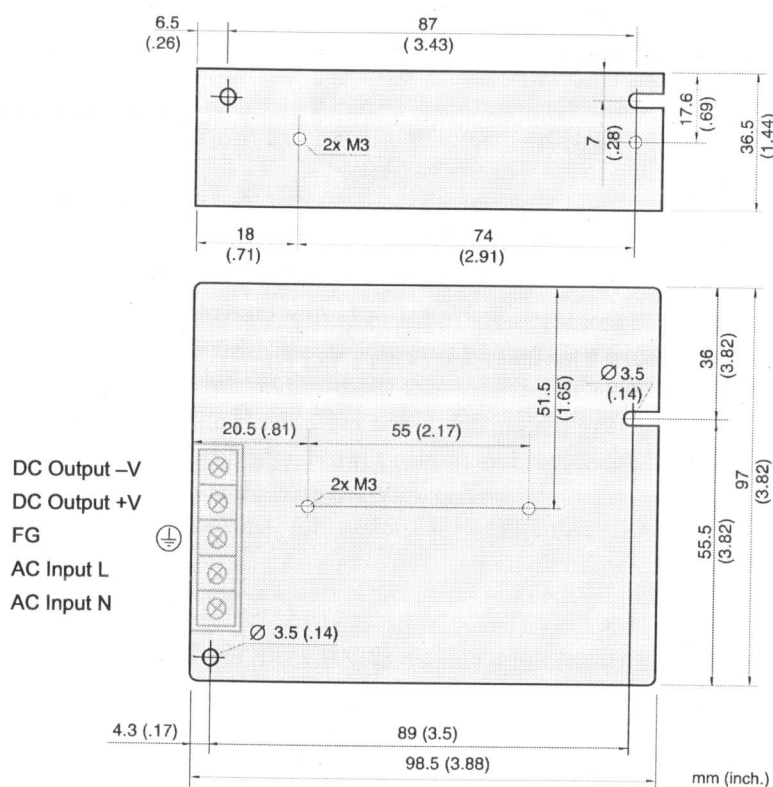


Figure 25: Dimension of Industrial Power Supply

## 6.9 Protective Window

Protective windows can be used to protect the sensor's optic against dust and other contaminations. For sensors with plastic lenses the use of a protective window combined with the air purge is strongly recommended.

The following table provides an overview of the available protective windows recommended for a LT, MT, HT, G5 and P7 model. All protective windows have a transmission below 100%.

Order number	Model	Designation	Material	Transmissivity	Use
XXXTXACTWL	LT	none	Amtir	$0.65 \pm 0.05$	max. 300°C (572°F)
XXXTXACTWX	LT	1 red dot	Zinc Sulphid	$0.75 \pm 0.05$	max. 250°C (482°F) non-poisonous
XXXTXACTWLF1	LT	none (stainless steel)	Polyethylene foil	$0.75 \pm 0.05$	for food applications, non-poisonous, non-fragile
XXXTXACTWM	MT	4 red dots	Sapphire	$0.88 \pm 0.05$	max. 1800°C (3272°F)
XXXTXACTWH	HT	3 red dots	Glass	$0.88 \pm 0.05$	max. 900°C (1652°F)
XXXTXACTWGP	G5, P7	2 red dots	Calcium Fluorid	$0.93 \pm 0.05$	max. 600°C (1112°F)

**Tab. 2: Protective Windows**

For special requirements, please ask our Sales Department about our range of special protective windows.

Models delivered with mounted protective windows are preset as follows:

- Basic model** Basic model has no adjustable parameter for the transmissivity. The influence of transmissivity is reflected by a resulting emissivity value. E.g. transmissivity of protective window is 0.88, emissivity of measured object is 0.95, resulting emissivity value is set with the two rotary switches to 0.84 ( $0.88 * 0.95 = 0.84$ )
- Smart model** Transmissivity for the protective window is set in the software directly. The emissivity value is not changed.

### Determination of transmissivity of an unknown protective window:

If transmissivity of the measuring screen is not indicated on the data sheet, you can also determine the transmissivity yourself. Please proceed as follows:

1. Measure the temperature of the target object with the sensing head, without using the protective window. Note correct setting of emissivity. With the basic model, emissivity is set with the two rotary switches. For the Smart model, the emissivity is entered in the software and the value for "Transmissivity" is specified as 1.00.
2. Insert the protective window in the sensing head.
3. If you use the **basic model** of the sensing head, adjust the emissivity until the same temperature is displayed, as was determined without the protective window.  
If the **smart model** is used, adjust the transmissivity in the software until the same temperature is displayed, as it was determined without the protective window.

For more information regarding the mounting of a protective window, see section 7.4 Replacing a Protective Window on page 27.

# Maintenance

---

## 7 Maintenance

Our customer service representatives are always at your disposal for any questions you might have. This service includes any support regarding the proper application of your infrared measuring system, calibration or the solution to customer-specific solutions as well as repair.

In many cases your problems will be applications-specific and can possibly be solved over the telephone. So, if you need to return equipment to us, please contact our Service Department before doing so, see phone and fax numbers at the beginning of this document.

### 7.1 Troubleshooting Minor Problems

Symptom	Possible Cause	Solution
No Output	Cable Disconnected	Check Cable Connections
Erroneous Temperature	Faulty Sensor Cable	Verify Cable's Integrity
Erroneous Temperature	Field of View Obstructed	Remove the Obstruction
Erroneous Temperature	Lens Dirty	Clean the Lens
Erroneous Temperature	Wrong Emissivity Setting	Correct the Setting
Temperature Fluctuates	Wrong Signal Processing	Correct Peak, Valley, or Average Settings

Tab. 3: Troubleshooting

### 7.2 Automatic Error Indication

The automatic error indication (alarm output) shall warn the user and guarantee a secure output in the event of a system error. In the first place, however, its task is to switch the system off in case of a faulty setup or a defect in the sensing head or in the electronic circuits.

Please select the desired Alarm Mode, see <Advanced Setup> in the menu <Sensor> <Sensor Setup> of the software.

- Off no alarm function
- Normally Open open output within the alarm thresholds
- Normally Closed closed output within the alarm thresholds
- Intern. Temp. n.c. open, if internal sensor temperature is exceeded
- Intern. Temp. n.o. closed if internal sensor temperature is exceeded



Never rely exclusively on the automatic error indication when monitoring critical heating processes. It is strongly recommended to take additional safety measures.

### 7.3 Cleaning the Lens

Care should be taken to keep the lens clean. Any foreign matter on the lens will affect the accuracy of the measurements. Be sure to take care when cleaning the lens. Please observe the following:

1. Blow off loose particles with clean air.
2. Gently brush off remaining particles with a soft camel hair brush.
3. To remove any more severe contamination use a clean, soft cloth dampened with distilled water. In any case, do not scratch the lens surface!

For finger prints or other grease, use any of the following:

- Denaturated alcohol
- Ethanol
- Kodak lens cleaner

Apply any of the above to the lens. Wipe gently with a clean, soft cloth until you see colors on the lens surface, then allow to air dry. Never wipe the surface dry, this may scratch the surface. If the lens is contaminated with silicones (e.g. from hand creams), clean it carefully using Hexane. Allow the lens to air dry.



**Do not use any ammonia or any cleaners containing ammonia to clean the lens.**  
**This may result in permanent damage to the lens' surface.**

### 7.4 Replacing a Protective Window

#### 7.4.1 Models produced after May 1999

**Attention!** Beginning production date **May 1999**, the models contain a thread allowing an easier protective window exchange. (If you received your model together with this manual, your model was produced after May 1999.) If you own an older model, refer to the description given in section 7.4.2 Models produced before May 1999 on page 28.

Make sure to use the appropriate protective window for the spectral range of your sensor model, for more information see section 6.9 Protective Window on page 25.

The window material is placed in a metal ring with a thread with an inner rubber gasket. This rubber gasket hermetically seals the sensor against atmospheric contaminants.

Replace the protective window using the special tool supplied with the spare window. Put the tools nozzles into the wholes on the window's mounting ring. Now gently unscrew the protective window from its mount by turning to the left. Take care to screw in the new protective window as tight as possible, but do not over tighten!

## Maintenance

---

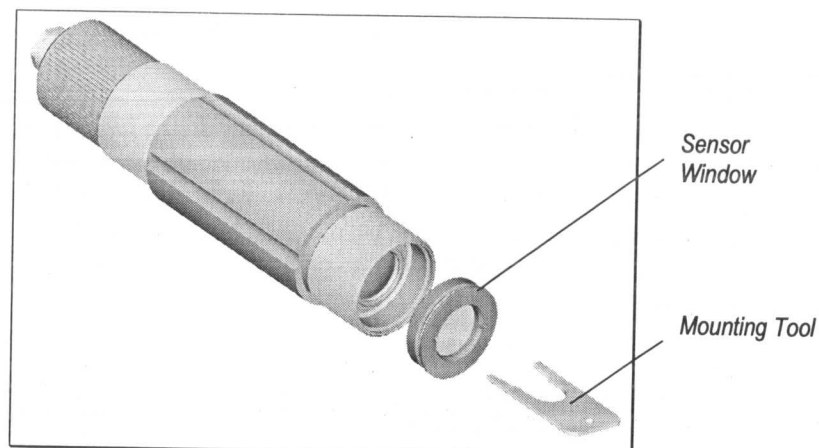


Figure 26: Replacing the Protective Window

### 7.4.2 Models produced before May 1999

**Attention!** If you own a model produced **before May 1999** and where the protective window looks similar to the one shown on the photographs below, refer to the following description.

Make sure to use the appropriate protective window for the spectral range of your sensor model, for more information see section 6.9 Protective Window on page 25.

The window material is placed in a metal ring which is enclosed with a rubber gasket. This rubber gasket keeps the protective window in the sensor. (Models produced later than May 1999 have a thread instead - check this, before you order spare parts!)

Replace the protective window using the plastic levers supplied with the spare window. Place the levers' blades beneath the projection of the protective window. Now gently lever the protective window from its mount.

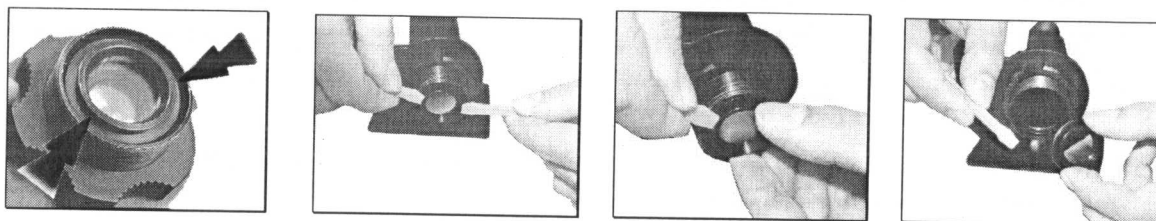


Figure 27: Replacing the Protective Window

### 8 Appendix

#### 8.1 Determination of Emissivity

Emissivity is a measure of an object's ability to absorb and emit infrared energy. It can have a value between 0 and 1.0. For example a mirror has an emissivity of 0.1, while the so-called "Blackbody" reaches an emissivity value of 1.0. If a higher than actual emissivity value is set, the output will read low, provided the target temperature is above its ambient temperature. For example, if you have set 0.95 and the actual emissivity is 0.9, the temperature reading will be lower than the true temperature.

An object's emissivity can be determined by one of the following methods:

1. Determine the actual temperature of the material using an RTD (PT100), a thermocouple, or any other suitable method. Next, measure the object's temperature and adjust emissivity setting until the correct temperature value is reached. This is the correct emissivity for the measured material.
2. For relatively low temperatures (up to 260°C, 500°F) place a plastic sticker on the object to be measured. This sticker should be large enough to cover the target spot. Next, measure the sticker's temperature using an emissivity setting of 0.95. Finally, measure the temperature of an adjacent area on the object and adjust the emissivity setting until the same temperature is reached. This is the correct emissivity for the measured material.
3. If possible, apply flat black paint to a portion of the surface of the object. The emissivity of the paint must be above 0.98. Next, measure the temperature of the painted area using an emissivity setting of 0.98. Finally, measure the temperature of an adjacent area on the object and adjust the emissivity until the same temperature is reached. This is the correct emissivity for the measured material.

#### 8.2 Typical Emissivity Values

The following table provides a brief reference guide for determining emissivity and can be used when one of the above methods is not practical. Emissivity values shown in the table are only approximate, since several parameters may affect the emissivity of a material. These include the following:

1. Temperature
2. Angle of measurement
3. Geometry (plane, concave, convex)
4. Thickness
5. Surface quality (polished, rough, oxidized, sandblasted)
6. Spectral range of measurement
7. Transmissivity (e.g. thin films plastics)

## Appendix

Material	METALS			
	Emissivity			
	1 $\mu\text{m}$	2.2 $\mu\text{m}$	5.1 $\mu\text{m}$	8 – 14 $\mu\text{m}$
Aluminum				
Unoxidized	0.1-0.2	0.02-0.2	0.02-0.2	0.02-0.1
Oxidized	0.4	0.2-0.4	0.2-0.4	0.2-0.4
Alloy A3003, Oxidized		0.4	0.4	0.3
Roughened	0.2-0.8	0.2-0.6	0.1-0.4	0.1-0.3
Polished	0.1-0.2	0.02-0.1	0.02-0.1	0.02-0.1
Brass				
Polished	0.35	0.01-0.05	0.01-0.05	0.01-0.05
Burnished	0.65	0.4	0.3	0.3
Oxidized		0.6	0.5	0.5
Chromium	0.4	0.05-0.3	0.03-0.3	0.02-0.2
Copper				
Polished	0.05	0.03	0.03	0.03
Roughened	0.05-0.2	0.05-0.2	0.05-0.15	0.05-0.1
Oxidized	0.2-0.8	0.7-0.9	0.5-0.8	0.4-0.8
Gold	0.3	0.01-0.1	0.01-0.1	0.01-0.1
Haynes				
Alloy	0.5-0.9	0.6-0.9	0.3-0.8	0.3-0.8
Inconel				
Oxidized	0.4-0.9	0.6-0.9	0.6-0.9	0.7-0.95
Sandblasted	0.3-0.4	0.3-0.6	0.3-0.6	0.3-0.6
Electropolished	0.2-0.5	0.25	0.15	0.15
Iron				
Oxidized	0.7-0.9	0.7-0.9	0.6-0.9	0.5-0.9
Unoxidized	0.35	0.1-0.3	0.05-0.25	0.05-0.2
Rusted		0.6-0.9	0.5-0.8	0.5-0.7
Molten	0.35	0.4-0.6	—	—
Iron, Cast				
Oxidized	0.9	0.7-0.95	0.65-0.95	0.6-0.95
Unoxidized	0.35	0.3	0.25	0.2
Molten	0.35	0.3-0.4	0.2-0.3	0.2-0.3
Iron, Wrought				
Dull		0.95	0.9	0.9

Tab. 4: Typical Emissivity Values

Material	METALS			
	Emissivity			
	1 $\mu\text{m}$	2.2 $\mu\text{m}$	5.1 $\mu\text{m}$	8 – 14 $\mu\text{m}$
Lead				
Polished		0.05-0.2	0.05-0.2	0.05-0.1
Rough		0.5	0.4	0.4
Oxidized		0.3-0.7	0.2-0.7	0.2-0.6
Magnesium	0.3-0.8	0.05-0.2	0.03-0.15	0.02-0.1
Mercury		0.05-0.15	0.05-0.15	0.05-0.15
Molybdenum				
Oxidized	0.5-0.9	0.4-0.9	0.3-0.7	0.2-0.6
Unoxidized	0.25-0.35	0.1-0.3	0.1-0.15	0.1
Monel (Ni-Cu)	0.3	0.2-0.6	0.1-0.5	0.1-0.14
Nickel				
Oxidized	0.8-0.9	0.4-0.7	0.3-0.6	0.2-0.5
Electrolytic	0.2-0.4	0.1-0.2	0.1-0.15	0.05-0.15
Platinum				
Black		0.95	0.9	0.9
Silver	0.04	0.02	0.02	0.02
Steel				
Cold-Rolled	0.8-0.9	—	0.8-0.9	0.7-0.9
Ground Sheet		0.6-0.7	0.5-0.7	0.4-0.6
Polished Sheet	0.35	0.2	0.1	0.1
Molten	0.35	0.25-0.4	0.1-0.2	—
Oxidized	0.8-0.9	0.8-0.9	0.7-0.9	0.7-0.9
Stainless	0.35	0.2-0.9	0.15-0.8	0.1-0.8
Tin (Unoxidized)	0.25	0.1-0.3	0.05	0.05
Titanium				
Polished	0.5-0.75	0.2-0.5	0.1-0.3	0.05-0.2
Oxidized		0.6-0.8	0.5-0.7	0.5-0.6
Tungsten		0.1-0.6	0.05-0.5	0.03
Polished		0.1-0.3	0.05-0.25	0.03-0.1
Zinc				
Oxidized	0.6	0.15	0.1	0.1
Polished	0.5	0.05	0.03	0.02

Tab. 5: Typical Emissivity Values



## Appendix

Material	NON-METALS			
	Emissivity			
	1 $\mu\text{m}$	2.2 $\mu\text{m}$	5.1 $\mu\text{m}$	8 – 14 $\mu\text{m}$
Asbestos	0.9	0.8	0.9	0.95
Asphalt		—	0.95	0.95
Basalt		—	0.7	0.7
Carbon				
Unoxidized		0.8-0.9	0.8-0.9	0.8-0.9
Graphite		0.8-0.9	0.7-0.9	0.7-0.8
Carborundum		0.95	0.9	0.9
Ceramic	0.4	0.8-0.95	0.8-0.95	0.95
Clay		0.8-0.95	0.85-0.95	0.95
Concrete	0.65	0.9	0.9	0.95
Cloth		—	0.95	0.95
Glass				
Plate		0.2	0.98	0.85
"Gob"		0.4-0.9	0.9	—
Gravel		—	0.95	0.95
Gypsum		—	0.4-0.97	0.8-0.95
Ice		—	—	0.98
Limestone		—	0.4-0.98	0.98
Paint (non-al.)		—	—	0.9-0.95
Paper (any color)		—	0.95	0.95
Plastic (opaque, over 20 mils)		—	0.95	0.95
Rubber		—	0.9	0.95
Sand		—	0.9	0.9
Snow		—	—	0.9
Soil		—	—	0.9-0.98
Water		—	—	0.93
Wood, Natural		—	0.9-0.95	0.9-0.95

Tab. 6: Typical Emissivity Values

To optimize surface temperature measurements, consider the following guidelines:

- Determine the object emissivity using the instrument which is also to be used for the measurements.
- Avoid reflections by shielding the object from surrounding temperature sources.
- For higher temperature objects use instruments with the shortest wavelength possible.
- For translucent materials such as plastic foils or glass, assure that the background is uniform and lower in temperature than the object.

## 8.3 Display Monitor

The Display Monitor GP (order number: RAYGPC/RAYGPCM) may be operated both with the standard and with the Smart model. The monitor allows Peak Hold, Valley Hold and Average and allows to adjust two setpoints for alarm- or control use. The display monitor requires a supply voltage of 110 VAC or 220 VAC. The monitor meets IP54 (IEC529, NEMA-12) requirements. The unit withstands ambient temperatures in between 0 to 50°C (32 to 120°F). The 1/8 DIN monitor provides a 4 to 20 mA signal input. The 4 digit LED display has a display resolution from 1°C (1°F). For more detailed information, please be referred to the GP manual.

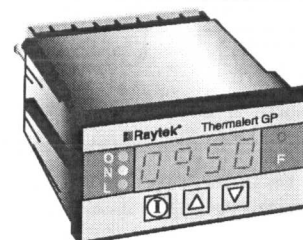


Figure 28: Monitor GP

### 8.3.1 Installation with the Sensor

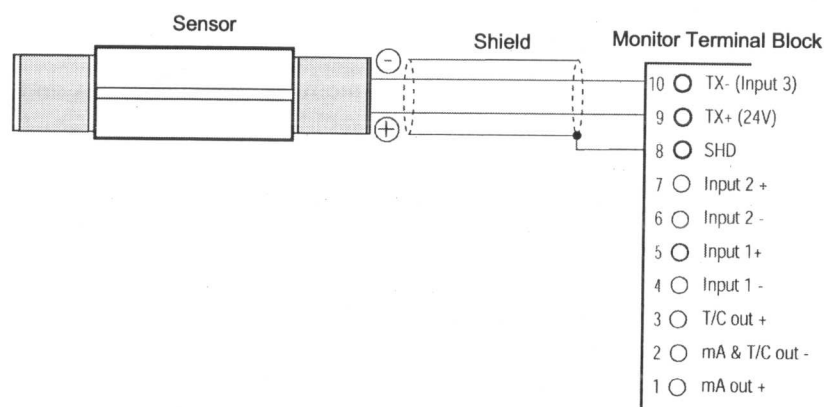


Figure 29: Sensor in analog communication, display with the monitor

The monitor can also be used to provide the power supply for a smart sensor in digital communication (pin 9: + 24 VDC, pin 10: ground). For activating the 4 – 20 mA current input, the monitor must be set to the device type **H005**, see the operating instructions for the monitor.

A possible installation is given in the figure below. For other installations see the figures in section 4.5 Smart Model on page 11.

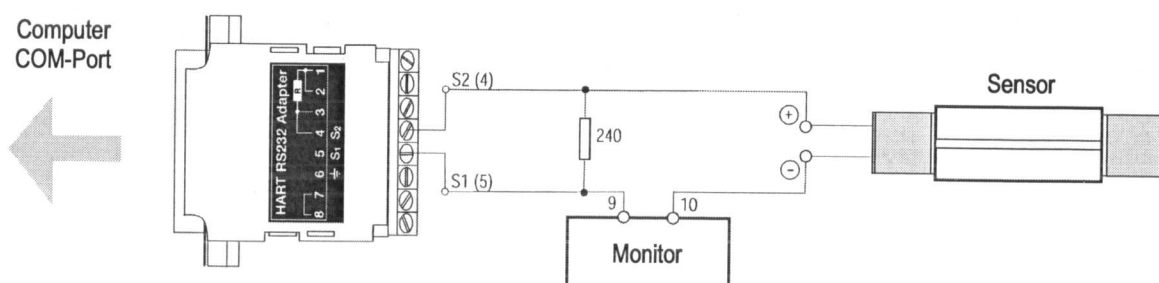


Figure 30: Sensor in digital communication, display and power with the monitor

## Appendix

### 8.4 Intrinsic Safety

The Smart unit is available with an optional Intrinsic Safety (IS) rating of **Ex II 2 G EEx ib IIC T4**. The power supply barrier for the unit must be ordered separately.

This intrinsically safe unit is available with a water cooled housing. The water cooled housing can provide a cooler, more stable operating environment for the electronics but does not allow for approved IS operation when external ambient conditions are above 70°C (158°F).

The recommended power supply barrier for the unit consists, in its simplest form, of two parts from the CONTRANS I series, manufactured by ABB Automation (formerly Hartmann & Braun):

- Intrinsically Safe isolating Driver, Part # V17151-620
- Din Rail mounted power supply Socket, Part # V17111-XXX

whereby XXX stands for the power specification:

110 – no integrated power supply, external voltage of 24 VDC necessary

120 – with integrated power supply for input voltages of 19 to 33 VDC

130 – with integrated power supply for input voltages of 95 to 253 VAC

The CONTRANS I interface modules are a series of driver modules, power supplies, and backplanes, all of which can be intermixed to provide the best solution for a specific application. The recommended solution, consisting of a single intrinsically safe isolating module and a single power supply socket, is only one of several combinations possible.

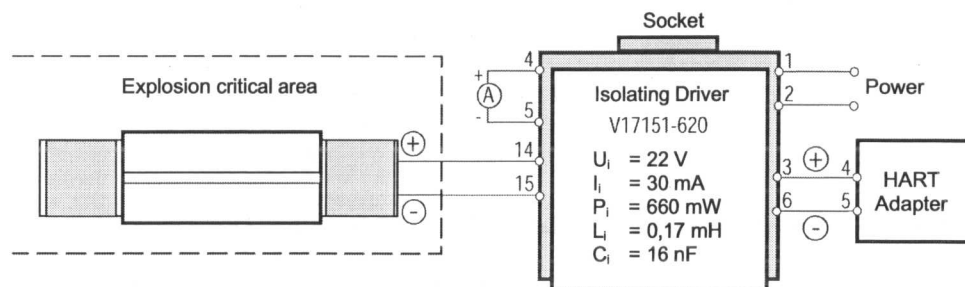


Figure 31: Intrinsic Safety Installation (example)

If you received a model with intrinsic safety option (shown on the housing), please consider the following IS Certificate of Conformity.



## EC-Type Examination Certificate

- (1)
- (2) Equipment and Protected Systems Intended for Use in Potentially Explosive Atmospheres - Directive 94/9/EC
- (3) EC-Type Examination Certificate Number



**PTB 03 ATEX 2234**

- (4) Equipment: Infrared Thermometer Type Thermalert TX
- (5) Manufacturer: ecom instruments GmbH
- (6) Address: Industriestr. 2, 97959 Assamstadt, Germany
- (7) The design of this equipment and its various approved embodiments are defined in the attachment to this type examination certificate.
- (8) The Physikalisch-Technische Bundesanstalt, notified body no. 0102 in accordance with Article 9 of the EC Council Directive dated March 23, 1994 (94/9/EC), certifies that this equipment has been found to conform with the essential health and safety requirements for the design and construction of equipment and protected systems for proper intended use in potentially explosive areas in accordance with Appendix II of the directive.  
The results of the test are documented in the confidential test report no. PTB Ex 03-23431.
- (9) The essential health and safety requirements are met by virtue of conformity with  
**EN 50014:1997 + A1 + A2** **EN 50020:2002**
- (10) If the certification number is followed by an "X", then this indicates that special conditions exist for the safe operation of the equipment. These special conditions are contained in the attachment to this certificate.
- (11) This EC-type examination certificate only refers to the design and checking of the specified equipment in accordance with directive 94/9/EC. Further requirements contained in this directive apply to the production and marketing of this equipment. These requirements are not covered by this certification.
- (12) The equipment must be labeled with the following information:



**II 2 G EEx ib IIC T4**

Certification Body for Explosion  
Protection  
On behalf of

Braunschweig, December 2, 2003

**Stamp**

Dr.-Ing. U. Johannsmeyer  
Governing Director

Page 1/2

EC-type examination certificates without signature and stamp are not valid.  
This EC-Type examination certificate may only be circulated without alteration.  
Extracts or alterations are subject to approval by the Physikalisch-Technischen Bundesanstalt.

Physikalisch-Technische Bundesanstalt • Bundesallee 100 • D-38116 Braunschweig, Germany

## Appendix

Physikalisch-Technische Bundesanstalt

Braunschweig and Berlin

PTB

### Attachment

(13)

(14)

#### EC-Type Examination Certificate PTB 03 ATEX 2234

(15) Description of the equipment

The infrared sensing head type Thermalert TX is used for the conversion of thermal energy emitted by a radiating surface into an electrical signal.

It may be used in potentially explosive areas.

The permitted ambient temperature is 70 °C.

Electrical data

Supply circuit and signal circuit

Connect only with a certified intrinsically safe circuit

Maximum values:

$U_i = 22 \text{ V}$

$I_i = 30 \text{ mA}$

$P_i = 660 \text{ mW}$

$L_i = 0.17 \text{ mH}$

$C_i = 16 \text{ nF}$

(16) Test report no. PTB Ex 03-23431

(17) Special conditions

(18) Essential health and safety standards

are met by virtue of conformity with the above-mentioned standards

Certification Body for Explosion

Protection

On behalf of

Dr.-Ing. U. Johannsmeyer  
Governing Director

Stamp

Braunschweig, December 2, 2003

This is to certify that the above is a complete and correct translation of the German original. The translation comprises 2 (two) pages.

Reutlingen, Germany, 12 December 2003

*Ilka Strobel*  
Ilka Strobel



Page 2/2

EC-type examination certificates without signature and stamp are not valid.

This EC-Type examination certificate may only be circulated without alteration.

Extracts or alterations are subject to approval by the Physikalisch-Technischen Bundesanstalt.

Physikalisch-Technische Bundesanstalt • Bundesallee 100 • D 38116 Braunschweig • Germany

## Index

---

Accessories .....	17, 20
Address .....	14, 15, 16
Address Assignment .....	13, 14, 15
Address Mode .....	14, 15, 16
Air Cooling .....	2, 6
Air Purge Collar .....	21, 22
Alarm Mode .....	26
Alarm Output .....	11, 16, 26
Ambient Temperature .....	6, 17, 19, 23, 33
Bracket, fixed .....	5, 9
Condensation .....	19
Emissivity .....	6, 7, 11, 22, 25, 29, 32
Focus .....	2, 6
HART Adapter .....	11, 13
Industrial Power Supply .....	24
Intrinsic Safety .....	34
Lens .....	4, 20, 26, 27
Maintenance .....	26
Optical Diagrams .....	3
Pipe Adapter .....	20, 22
Polling Address .....	13, 14, 15, 16
Resistor, external .....	12, 14
Resistor, internal .....	12, 14
Right Angle Mirror .....	20, 21, 22
Sighting Viewer .....	20, 22
Spot Size .....	3, 6
Tag Mode .....	15, 16
ThermoJacket Housing .....	2, 7, 23
Thread Adapter .....	18
Transmissivity .....	25, 29
Water Cooling .....	2, 6, 23
Wire Cross Sections .....	8

---